

Navigator 600 Analyzers – Updating the Software

1 Introduction

This publication details the software update procedure for Navigator 600 Series analyzers.

2 Update Procedure

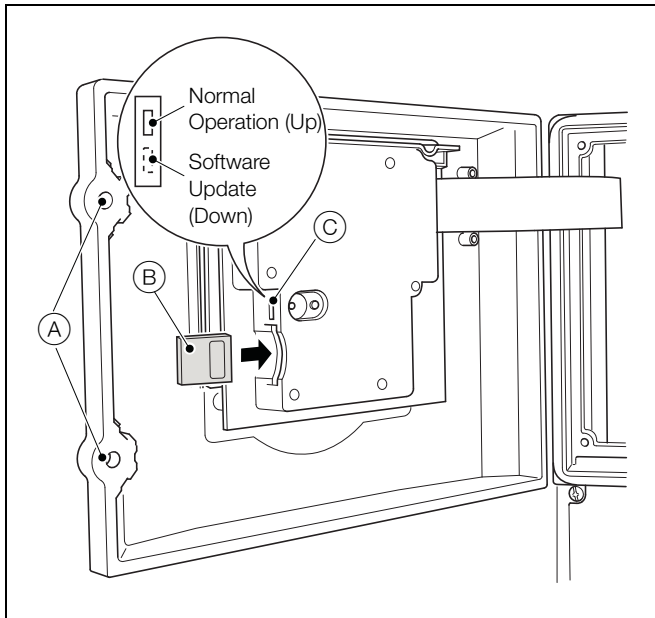


Fig. 2.1 SD Card Removal

1. Unzip the upgrade software file and place the contents of the folder created onto an SD card.

Note. Use only genuine SanDisk SD cards with a capacity of 2 Gb or less.

2. Ensure the analyzer is switched off.
3. Use a large flat-headed screwdriver to release the two door catches (A).
4. Remove the SD card (B) if present.
5. Set the switch (C) (above the SD card socket) to the lower position (Software Update).

6. Insert the software update SD card, close the door and switch on the analyzer. A start-up message appears for a short duration (approximately 5 seconds) followed by an 'ABB' splash screen:

```
VRD iMX21 Bootloadetr V1.2
*****
```



7. A 'Warning' screen appears next. This provides the option to upgrade the existing system software, or exit without upgrading:

Warning


The System Boot switch is in the down position.

System Upgrade – Press Enter

Power off the unit, Move the System Boot switch to the up position and Power on

8. To proceed, press the **↵** key.

The 'Commissioning' screen appears with the 'Upgrade Firmware' button selected:

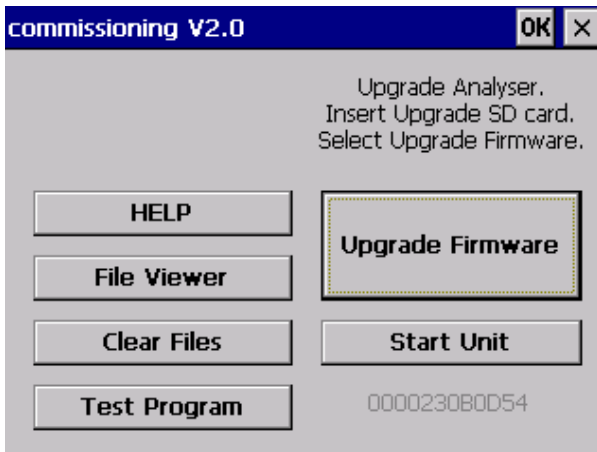

9. To start the system software upgrade process, press the **↵** key. The software is transferred to the analyzer in sections.
10. Press the **↵** key as each section is installed (installation may take a few moments).
11. Once all sections of step 11 are complete, turn power off.
12. Open the door and remove the software upgrade SD card.
13. Return switch (C) to the top position.
14. Replace any SD card removed in step 4.
15. Close the door and restore power to the unit.

Notes

ABB has Sales & Customer Support expertise
in over 100 countries worldwide

www.abb.com

The Company's policy is one of continuous product
improvement and the right is reserved to modify the
information contained herein without notice.

Printed in UK (08.09)

© ABB 2009



ABB Limited
Oldends Lane, Stonehouse
Gloucestershire
GL10 3TA
UK
Tel: +44 (0)1453 826661
Fax: +44 (0)1453 829671

ABB Inc.
125 E. County Line Road
Warminster
PA 18974
USA
Tel: +1 215 674 6000
Fax: +1 215 674 7183